



BRANZ **Technical Opinion**

FAR 4709-**T.O.** [2017] ISSUE 2

FIRE RESISTANCE OF INSPECTION HATCHES IN FIRE RATED FLOOR/CEILING SYSTEMS.

CLIENT
Principal Products Ltd
Unit J, 657 Great South Road
Penrose
Auckland 1061

ASSESSMENT SUMMARY

Objective

To assess the fire resistance of the Firestop Centre Inspection Hatch Fire-rated 300 (FSC 300) when installed in GIB® fire rated floor/ceiling systems in accordance with AS 1530.4-2005 or AS 1530.4-2014.

Client

Principal Products Ltd
Unit J, 657 Great South Road
Penrose
Auckland 1061

Conclusion

It is considered that the Hatch FSC 300 would maintain the stated FRR if installed in the following GIB® fire rated floor/ceiling systems if tested in accordance with AS 1530.4-2005 or AS 1530.4-2014 subject to the following conditions:

60/60/60

- GBCJ 60 – 1 x 16 mm GIB Fyrelite®
- GBSC 60a – 2 x 13 mm GIB Fyrelite®
- GBUC 60 – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®
- GBDFa 60c – 2 x 13 mm GIB Noiseline®
- GBDFa 60b – 2 x 13 mm GIB Fyrelite®
- GBSCA 60a – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®

45/45/45

- GBFC 45* – 1 x 13 mm GIB Fyrelite®
- GBCJ 45* – 1 x 13 mm GIB Fyrelite®
- GBUC 45 – 2 x 13 mm GIB Fyrelite®
- GBSCA 45 – 2 x 13 mm GIB Fyrelite®

30/30/30

- GBSJ 30* – 1 x 13 mm GIB Fyrelite®
- GBCJ 30* – 1 x 13 mm GIB Fyrelite®
- GBSC 30* – 1 x 13 mm GIB Fyrelite®
- GBUC 30 – 1 x 16 mm GIB Fyrelite®
- GBDFa 30a – 2 x 13 mm GIB® standard plasterboard
- GBDFa 30d* – 1 x 13 mm GIB Noiseline®

15/15/15


- GBFC 15* – 1 x 13 mm GIB Fyrelite®
- GBUC 15 – 1 x 13 mm GIB Fyrelite®

* The inspection panels must be independently supported from the plasterboard.



REPORT NUMBER:	ISSUE DATE:	EXPIRY DATE:	PAGE:
FAR 4709-T.O. Issue 2	10 August 2017	10 August 2022	2 of 12

THIS REPORT IS ONLY VALID WHEN A TYPE TEST SUMMARY APPEARS ON THE BRANZ LTD WEBSITE WWW.BRANZ.CO.NZ.
EXTRACTS OR ABRIDGEMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

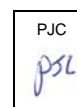

Subject to the following:

- The Hatch FSC 300 may be hung directly from the plasterboard without supporting framing except for the systems noted with an “*” above.
- The inspection panel can be installed in any location within the 600 mm x 600 mm area but is limited to only one within this area.
- The minimum cavity size shall not be less than tested at 200 mm in height as per the GIB® specification.

Variations to the construction of the inspection hatch

- The size of the inspection hatch can be reduced in length, width or both.
- The frame corner angles can be secured with M4 x 40 mm CSK screws or where the thickness of the lining is greater than 16 mm the same screw length as specified in the relevant GIB® fire rated floor/ceiling system.
- The screws securing the inspection panel cover are replaced with M4 x 10 STL pan head screws.
- Alternative contact adhesive with similar properties to that tested.

LIMITATION

The results reported here relate only to the item/s described in this report.

This report is subject to the accuracy and completeness of the information supplied.

BRANZ reserves the right to amend or withdraw this assessment if information becomes available which indicates the stated fire performance may not be achieved.

This assessment report may only be quoted or reproduced in full.


TERMS AND CONDITIONS

This report is issued in accordance with the Terms and Conditions as detailed and agreed in the BRANZ Services Agreement for this work.




REPORT NUMBER:	ISSUE DATE:	EXPIRY DATE:	PAGE:
FAR 4709-T.O. Issue 2	10 August 2017	10 August 2022	3 of 12

THIS REPORT IS ONLY VALID WHEN A TYPE TEST SUMMARY APPEARS ON THE BRANZ LTD WEBSITE WWW.BRANZ.CO.NZ.
EXTRACTS OR ABRIDGEMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

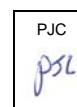


CONTENTS

SIGNATORIES	5
DOCUMENT REVISION STATUS	5
1. INTRODUCTION	6
2. BACKGROUND	6
2.1 Fire Resistance Tests	6
3. DISCUSSION	6
3.1 General.....	6
3.2 GIB® GBFC 60 floor/ceiling system	7
3.3 Inspection Hatch design	7
3.4 GIB® 60/60/60 floor/ceiling system	8
3.4.1 GIB® Fire rated system manual 2012	8
3.4.2 GIB® Noise control systems manual 2012.....	8
3.5 GIB® 45/45/45 floor/ceiling system	8
3.6 GIB® 30/30/30 and 15/15/15 floor/ceiling system.....	9
4. CONCLUSION	10

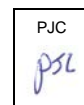

SIGNATORIES

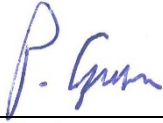

Author

P. Chapman
Senior Fire Testing Engineer



Reviewer

E. Soja
Senior Fire Safety Engineer

DOCUMENT REVISION STATUS

ISSUE NO.	DATE ISSUED	EXPIRY DATE	DESCRIPTION
1	29 May 2017	29 May 2022	Initial Issue
2	10 August 2017	10 August 2022	Amendment to system installation detail.



REPORT NUMBER:

**FAR 4709-T.O.
Issue 2**

ISSUE DATE:

10 August 2017

EXPIRY DATE:

10 August 2022

PAGE:

5 of 12

THIS REPORT IS ONLY VALID WHEN A TYPE TEST SUMMARY APPEARS ON THE BRANZ LTD WEBSITE WWW.BRANZ.CO.NZ.
EXTRACTS OR ABRIDGEMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

1. INTRODUCTION

This report gives BRANZ's assessment of the fire resistance of the Firestop Centre Inspection Hatch Firerated 300 (FSC 300) when installed in a GIB® fire rated floor/ceiling system for up to a fire resistance rating (FRR) of 60/60/60 if tested in accordance with AS 1530.4-2005 or AS 1530.4-2014.

2. BACKGROUND

2.1 Fire Resistance Tests

In fire resistance test FP 5958 two inspection hatches FSC 300 were tested in a fire rated floor/ceiling system except of reduced scale. The inspection hatches were nominally 300 mm x 300 mm installed in one layer of 16 mm thick GIB® Fyrelite® plasterboard. The floor/ceiling system consisted of 140 mm x 45 mm timber joists at 600 mm centres with full blocking which provided three cavities nominally 600 mm x 600 mm. To the top surface was nominal 20 mm thick particle board flooring. One of the hatches was positioned in the middle of the cavity while the other was secured to the framing on one side only.

In BRANZ fire resistance test FR 1370 a loadbearing floor/ceiling system was tested in accordance with AS 1530.4. The tested specimen consisted of joists at nominally 600 mm centres, 16 mm thick GIB® Fyrelite plasterboard to the underside and 20 mm thick particle board flooring. The floor/ceiling system maintained the failure criteria for in excess of 60 minutes.



Both the GIB® Fire rated system manual 2012 and GIB® Noise control systems manual 2006 have a current BRANZ appraisal certificate and have been reviewed to determine that the listed systems would achieve their stated fire resistance ratings (FRR).

3. DISCUSSION

3.1 General

In fire resistance test FP 5958 one of the hatches was installed in the centre of the unsupported area of ceiling lining created by the timber joists and solid blocking at nominally 600 mm x 600 mm centres. This is considered to be the most severe position with respect to causing failure of the ceiling due to pulling the lining off the timber during fire exposure. The other was positioned against one side of the framing and secured into the solid blocking.

The inspection hatch FSC 300 tested in FP 5958 consisted of a folded mild steel frame which was secured through the plasterboard facing to mild steel corner brackets above, effectively sandwiching the perimeter of the plasterboard. The removable hatch consisted of a mild steel cover with an insulating panel 14.5 mm thick with an intumescent seal around the perimeter. The cover was secured to the frame at the corners. The hatch was nominally 300 mm x 300 mm.

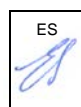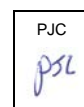

3.2 GIB® GBFC 60 floor/ceiling system

The GIB® GBFC 60 floor/ceiling system consists of a single layer of 16 mm thick GIB Fyrelite® plasterboard with timber joists and a particle board flooring with a fire resistance rating (FRR) of 60/60/60.

In fire resistance test FP 5958 the inspection panels were tested in a reduced size GIB® GBFC 60 floor/ceiling system with a maximum un-supported area of 600 mm x 600 mm. A comparison has been made between the temperatures measured in the two cavities with inspection panels and the control cavity without any penetration. It is determined that the temperature on the plasterboard near the inspection panel frame is higher than the control plasterboard, however the panel itself had a lower temperature at 60 minutes. Temperatures were also measured on the side of the joists which indicated charring occurred approximately 4 minutes earlier than the control. Temperatures were also made to the underside of the flooring panel above, which were similar to the control.

In fire resistance test FR 1370 the load bearing floor ceiling system achieved a fire resistance in excess of 60 minutes. Based on the temperatures measured in fire resistance test FP 5958 the charring of the timber joists is likely to occur 4 minutes earlier with an inspection panel installed than without. When taking into account the performance achieved in FR 1370 in excess of the 60 minute requirement it is considered that the installation of the inspection panels is unlikely to prejudice the fire resistance before at least 60 minutes. Therefore it is considered the inspection panel can be installed into a GIB® GBFC 60 floor/ceiling system and maintain the FRR of at least 60/60/60 subject to the following:


- The inspection panel can be installed in any location within the 600 mm x 600 mm area but is limited to only one within this area.
- The minimum cavity size shall not be less than tested at 200 mm in height as per the GIB® specification.

3.3 Inspection Hatch design

The inspection hatch tested was nominally 300 mm x 300 mm. It is proposed to reduce the size of the inspection hatch in length or width or both. Based on the performance of the tested hatch it is considered that a reduction in dimension would not be detrimental to the fire performance of the inspection panel.

In fire resistance test FP 5958 the frame was secured to the corner angles with M4 screws and wing nuts. It is proposed to replace the screws/wing nuts with M4 x 40 mm CSK screws. It is considered that the stress on the screws would not be sufficient to pull out of the corner angles during fire exposure and therefore would not prejudice the fire performance of the inspection hatch. Where the thickness of the ceiling lining is increased the length of screw must be at least the same as specified in the GIB® fire rated floor/ceiling system for that lining configuration.

In FP 5958 the cover panel was secured with M4 screws and clinch nuts. It is proposed to replace these with an M4 x 10 STL pan head screw. It is considered the change in screw fixing is minor in nature and would not prejudice the fire performance of the inspection panel.

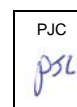

The inspection panel was assembled using ADOS contact adhesive. It is considered that alternative contact adhesive may be used on the condition it has similar properties to that tested.

3.4 GIB® 60/60/60 floor/ceiling system

3.4.1 GIB® Fire rated system manual 2012

The GIB® Fire rated system manual 2012 includes floor/ceiling systems with an FRR of 60/60/60. The systems are as follows:

- GBCJ 60 – 1 x 16 mm GIB Fyrelite®
- GBSC 60a – 2 x 13 mm GIB Fyrelite®
- GBUC 60 – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®

The floor/ceiling system tested in FP 5958 was selected as likely to be the most severely affected by the presence of the inspection panels compared to the other 60 minute systems. The systems with a single layer of 16 mm thick GIB Fyrelite® have deeper cavities which is likely to be beneficial or consist of more layers of plasterboard. Therefore it is considered that the inspection panels can be installed in the above GIB® fire rated floor/ceiling systems and maintain their FRR for at least 60/60/60 subject to the conditions stated in section 3.2.

3.4.2 GIB® Noise control systems manual 2012

The GIB® Noise control systems manual 2006 includes floor/ceiling systems with an FRR of 60/60/60. The systems are as follows:

- GBDFa 60c – 2 x 13 mm GIB Noiseline®
- GBDFa 60b – 2 x 13 mm GIB Fyrelite®
- GBSCa 60a – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®

As discussed above in section 3.4.1 above it is considered that the inspection panels can be installed in the above GIB® fire rated floor/ceiling systems and maintain their FRR for at least 60/60/60 subject to the conditions stated in section 3.2.

3.5 GIB® 45/45/45 floor/ceiling system


The GIB® Noise control systems manual 2006 includes floor/ceiling systems with an FRR of 45/45/45. The systems are as follows:

- GBFC 45* – 1 x 13 mm GIB Fyrelite®
- GBCJ 45* – 1 x 13 mm GIB Fyrelite®
- GBUC 45 – 2 x 13 mm GIB Fyrelite®

The GIB® Noise control systems manual 2006 includes floor/ceiling systems with an FRR of 45/45/45. The systems are as follows:

- GBSCa 45 – 2 x 13 mm GIB Fyrelite®

As discussed above in section 3.4.1 the supporting data for each of the above systems have been compared with the performance of the inspection panels in FP 5958 with respect to

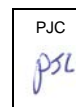

their performance and temperatures obtained at 45 minutes. Based on this comparison it is considered that the inspection panels can be installed in the above GIB® fire rated floor/ceiling systems and maintain their FRR for at least 45/45/45 subject to the conditions stated in section 3.2.

* The inspection panels must be independently supported from the plasterboard.

3.6 GIB® 30/30/30 and 15/15/15 floor/ceiling system

The GIB® Noise control systems manual 2006 includes floor/ceiling systems with an FRR of 15/15/15 and 30/30/30. The systems are as follows:


- GBFC 15* – 1 x 13 mm GIB Fyrelite®
- GBUC 15 – 1 x 13 mm GIB Fyrelite®
- GBSJ 30* – 1 x 13 mm GIB Fyrelite®
- GBCJ 30* – 1 x 13 mm GIB Fyrelite®
- GBSC 30* – 1 x 13 mm GIB Fyrelite®
- GBUC 30 – 1 x 16 mm GIB Fyrelite®

The GIB® Noise control systems manual 2006 includes floor/ceiling systems with an FRR of 30/30/30. The systems are as follows:

- GB DFA 30a – 2 x 13 mm GIB® standard plasterboard
- GB DFA 30d* – 1 x 13 mm GIB Noiseline®

As discussed above in section 3.4.1 the supporting data for each of the above systems have been compared with the performance of the inspection panels in FP 5958 with respect to their performance and temperatures obtained at 15 and 30 minutes. Based on this comparison it is considered that the inspection panels can be installed in the above GIB® fire rated floor/ceiling systems and maintain their FRR for at least 15/15/15 or 30/30/30 as appropriate subject to the conditions stated in section 3.2.

* The inspection panels must be independently supported from the plasterboard.

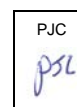

4. CONCLUSION

It is considered that the Hatch FSC 300 would maintain the stated FRR if installed in the following GIB® fire rated floor/ceiling systems if tested in accordance with AS 1530.4-2005 or AS 1530.4-2014 subject to the following conditions:

60/60/60

- GBCJ 60 – 1 x 16 mm GIB Fyrelite®
- GBSC 60a – 2 x 13 mm GIB Fyrelite®
- GBUC 60 – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®
- GBDFa 60c – 2 x 13 mm GIB Noiseline®
- GBDFa 60b – 2 x 13 mm GIB Fyrelite®
- GBSCA 60a – 1 x 16 mm + 1 x 13 mm GIB Fyrelite®

45/45/45

- GBFC 45* – 1 x 13 mm GIB Fyrelite®
- GBCJ 45* – 1 x 13 mm GIB Fyrelite®
- GBUC 45 – 2 x 13 mm GIB Fyrelite®
- GBSCA 45 – 2 x 13 mm GIB Fyrelite®

30/30/30

- GBSJ 30* – 1 x 13 mm GIB Fyrelite®
- GBCJ 30* – 1 x 13 mm GIB Fyrelite®
- GBSC 30* – 1 x 13 mm GIB Fyrelite®
- GBUC 30 – 1 x 16 mm GIB Fyrelite®
- GBDFa 30a – 2 x 13 mm GIB® standard plasterboard
- GBDFa 30d* – 1 x 13 mm GIB Noiseline®



15/15/15

- GBFC 15* – 1 x 13 mm GIB Fyrelite®
- GBUC 15 – 1 x 13 mm GIB Fyrelite®

* The inspection panels must be independently supported from the plasterboard.

Subject to the following:

- The Hatch FSC 300 may be hung directly from the plasterboard without supporting framing except for the systems noted with an “*” above.
- The inspection panel can be installed in any location within the 600 mm x 600 mm area but is limited to only one within this area.
- The minimum cavity size shall not be less than tested at 200 mm in height as per the GIB® specification.

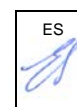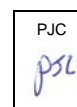


Variations to the construction of the inspection hatch

- The size of the inspection hatch can be reduced in length, width or both.
- The frame corner angles can be secured with M4 x 40 mm CSK screws or where the thickness of the lining is greater than 16 mm the same screw length as specified in the relevant GIB® fire rated floor/ceiling system.
- The screws securing the inspection panel cover are replaced with M4 x 10 STL pan head screws.
- Alternative contact adhesive with similar properties to that tested.



REPORT NUMBER:	ISSUE DATE:	EXPIRY DATE:	PAGE:
FAR 4709-T.O. Issue 2	10 August 2017	10 August 2022	11 of 12

THIS REPORT IS ONLY VALID WHEN A TYPE TEST SUMMARY APPEARS ON THE BRANZ LTD WEBSITE WWW.BRANZ.CO.NZ.
EXTRACTS OR ABRIDGEMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

PJC 
--

ES 

BRANZ Technical Opinion Summary

**This is to certify that the specimen described below has
been examined by BRANZ Ltd on behalf of**

Principal Products Ltd
Unit J, 657 Great South Road
Penrose
Auckland 1061

Test standard: AS 1530.4-2005 or AS 1530.4-2014

Specimen name: Inspection Hatch FSC 300

Specimen description: Steel framed inspection hatch up to 300 mm x 300 mm

Installed into the following GIB® fire rated floor/ceiling systems:

60/60/60 - GBCJ 60, GBSC 60a, GBUC 60, GBDFa 60c, GBDFa 60b & GBSCA 60a

45/45/45 - GBFC 45*, GBCJ 45*, GBUC 45 & GBSCA 45

30/30/30 – GBSJ 30*, GBCJ 30*, GBSC 30*, GBUC 30, GBDFa 30a & GBDFa 30d*

15/15/15 – GBFC 15* & GBUC 15

* The inspection panels must be independently supported from the plasterboard.

Orientation: From the underside only.

**A full description of the performance assessment is given in BRANZ Technical Opinion:
FAR 4709 T.O. [2017] Issue 2 issued 10 August 2017**

**Regulatory authorities are advised to examine the full technical opinion before
approving any product.**

As per the GIB® fire rated floor/ceiling system up to an FRR of 60/60/60

Issue Date:
10 August 2017

Expiry Date:
10 August 2022



REPORT NUMBER:	ISSUE DATE:	EXPIRY DATE:	PAGE:
FAR 4709-T.O. Issue 2	10 August 2017	10 August 2022	12 of 12

THIS REPORT IS ONLY VALID WHEN A TYPE TEST SUMMARY APPEARS ON THE BRANZ LTD WEBSITE WWW.BRANZ.CO.NZ.
EXTRACTS OR ABRIDGEMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

